ANACONDA

7/21/06

A-1, surface detail with voids

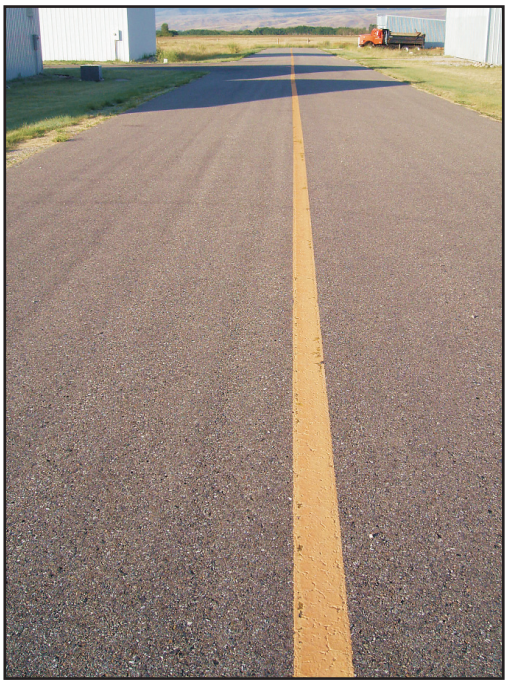

T-1, overview

T-5, overview

T-4, overview with patches

ANACONDA

7/21/06

A-2, patch & filled cracks

T-2, surface detail

R-1, surface detail with bleeding bubbles

R-2, overview with edge grass

ANACONDA

7/21/06

T-2, overview

T-2, surface detail

ANACONDA

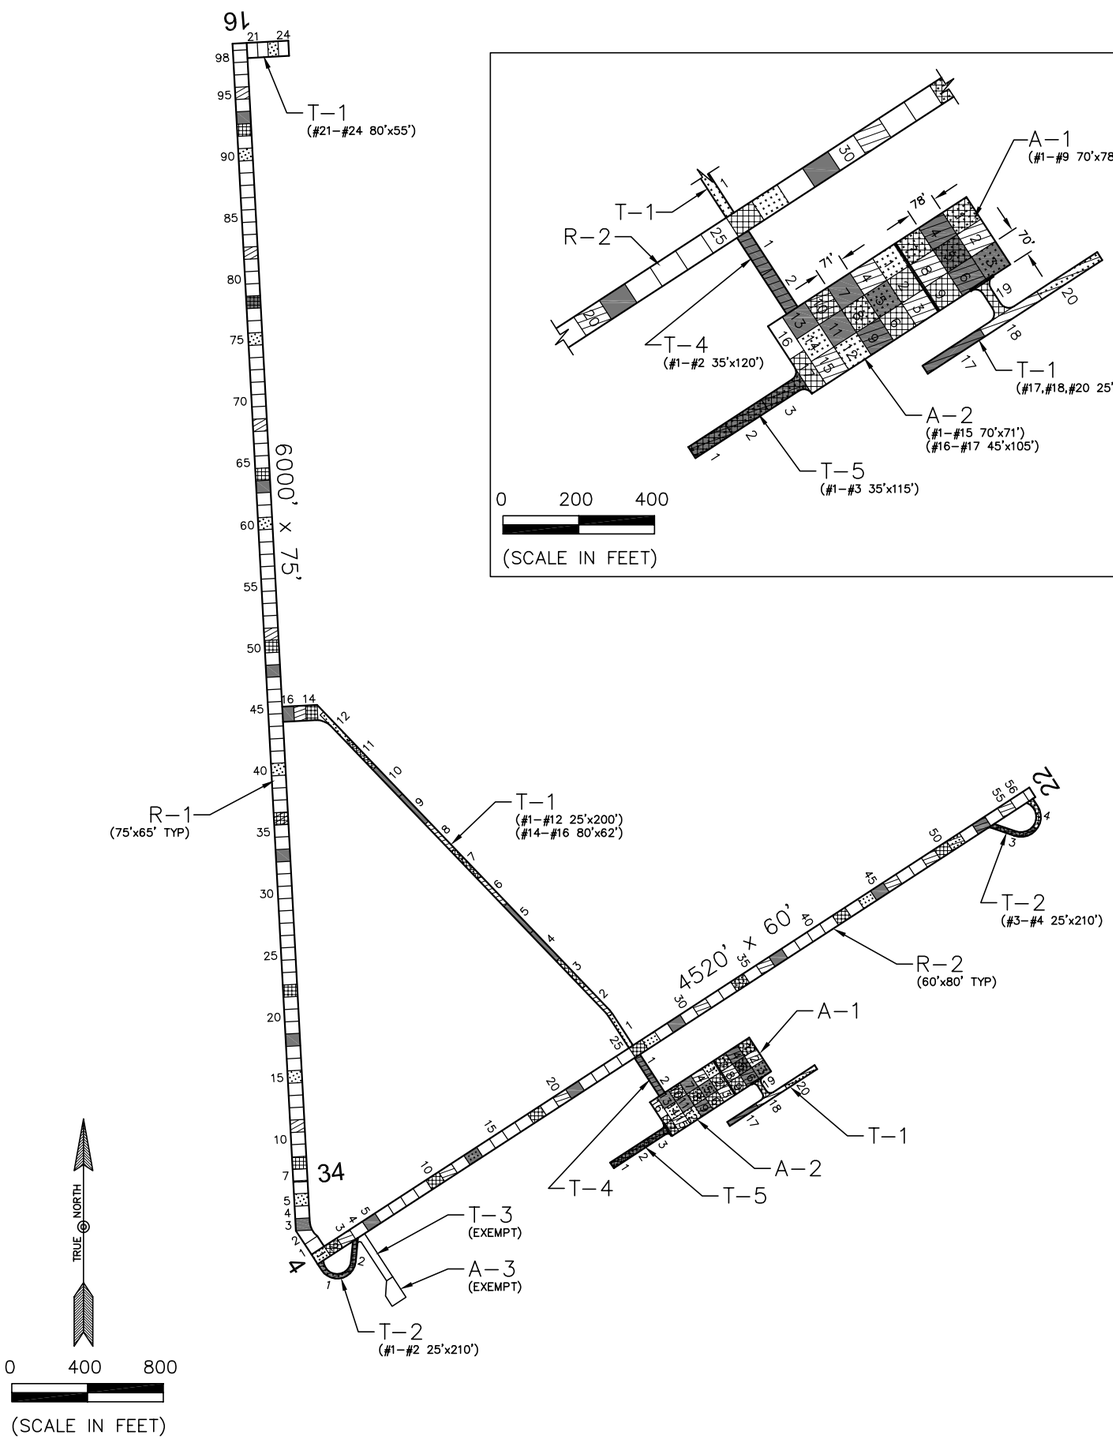

PAVEMENT STRENGTH SURVEY/PAVEMENT CONDITION SURVEY

ANACONDA

PAVE. IDENT.	SOIL CLASS	SUB GRADE CLASS	SUBBASE COURSE	BASE COURSE	SURFACE COURSE	OVERLAY	PAVEMENT STRENGTH MAX. GROSS LOAD (LBS) SINGLE	DUAL	DUAL TAN.	REMARKS
RUNWAYS										
R-1				9" P-208	3" P-401	P-609	12,500			2 4
R-2				9.7" P-208	4" P-401	P-609	12,500			3 4
TAXIWAYS										
T-1				9" P-208	3" P-401	P-609	12,500			2 4
T-2				9.7" P-208	4" P-401	P-609	12,500			3 4
T-3						P-609				A
T-4	E-1	F1		6" P-208	2" P-401	P-609	30,000			1 4
T-5				9.7" P-208	4" P-401	P-609	12,500			3 4
APRONS										
A-1				9" P-208	3" P-401	P-609	12,500			2 4
A-2				9.7" P-208	4" P-401	P-609	12,500			3 4

REMARKS:

A UNKNOWN-CONSTRUCTED NON-FED, NO INFORMATION AVAILABLE, STRENGTHS ASSUMED.

1 AIP-01, 1985, REHABILITATE RUNWAY 4-22, TURNAROUNDS, APRON, AND CONNECTING TAXIWAY.
2 AIP-02, 1992, CONSTRUCT RUNWAY 16-34, CONNECTING AND ACCESS TAXIWAYS; APRON EXPANSION.
3 AIP-03, 1993, REHABILITATE RUNWAY (R-2) AND APRON, CONSTRUCT TAXIWAY (T-5).
4 AIP-04, 2001, CRACK SEAL, FOG SEAL, AND REMARK ALL PAVEMENTS.
5 AIP-008, 2006, CRACK SEAL, FOG SEAL, AND REMARK ALL PAVEMENTS (INSPECTED PRIOR TO COMPLETION).

LEGEND

- 1994 SURVEY AREA
- 1997 SURVEY AREA
- 2000 SURVEY AREA (NOT SURVEYED)
- 2003 SURVEY AREA
- 2006 SURVEY AREA

DATE OF PAVEMENT STRENGTH SURVEY:	
EVALUATED BY:	
DATE OF MOST RECENT PAVEMENT CONDITION SURVEY:	JULY 21, 2006
EVALUATED BY:	B. BURKLAND

MONTANA AVIATION SYSTEM PLAN
2006 UPDATE - PAVEMENT CONDITION INDEXES

BOWMAN FIELD

PREPARED FOR: MONTANA AERONAUTICS DIVISION

ANACONDA
MONTANA

DATE: NOV. 2006

PREPARED BY: ROBERT PECCIA & ASSOCIATES